


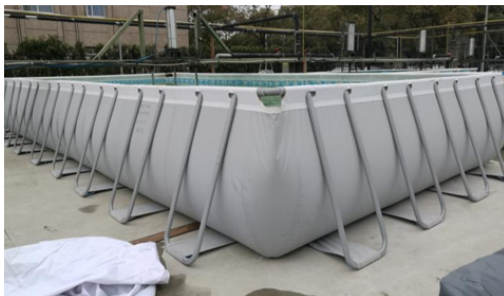



QA Test Report

Report No.	20160219-217-01	Report Date	2016-03-22
Start Date	2016-02-19	Finish Date	2016-03-21
Application Dept	AGP team	Applicant	Zhongxiong Zhu
Sample Code	56625-BWSHE02336S	Sample Description	Mass Production Inspection
Quantity	2	Sample Provide Date	2016-02-19
Sample Types	Mass Production Sample		
Test Purpose	Regular Inspection for pool mass production		
QATest Method	<p>Place the pool under beating machine, beats for 30 days, with beating frequency of 25 cycles per minute. Beating depth: 50 – 60 cm.</p> <ul style="list-style-type: none"> ■ Beating machine works 24 hours a day; ■ Everyday keep the water level to be 90% by refilling. ■ The pool is not allowed to have any structural defects, leakages, or breakages. ■ Measure the dimensions of the pool before and after the beating test, the difference should be within 2% 		
Photo During Test	<p>Install the pool and measure the dimensions of the pool</p> <ul style="list-style-type: none"> - Check the length, width, and height of the pool <div>    </div> <ul style="list-style-type: none"> - Put the pool under beating test for 30 days <div>   </div>		


QA Test Report

After beating test, remeasure the dimensions of the pool



Photo After Test

Pool structure after beating test

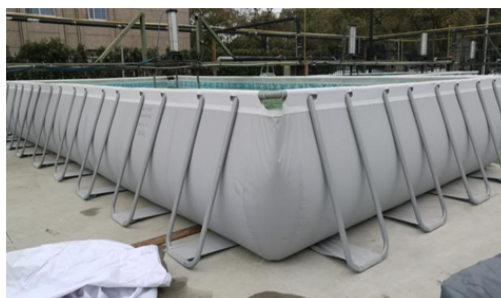

	Before Test/cm	After Test/cm	Difference/cm	Remark
Pool Length	943	942	-1	-0.1%
Pool Width	485	486	1	0.2%
Pool Height	132	132	0	0%

Test Result

Assembly	PASS
Dimensions	PASS
Life Test	PASS
Other	N/A
Conclusion	PASS

Remark

QA Team Leader/Date

2016-03-22

QA Manager/Date

2016-03-22